

© 2016 Mazda Motor of America, Inc.


<b>Subject:</b> <b>SEAT BELT COMES OUT OF SEAT BELT GUIDE WHEN RETRACTING</b>	<b>Bulletin No:</b> 08-002/16
	<b>Last Issued:</b> 04/29/2016

## APPLICABLE MODEL(S)/VINS


2016 MX-5 vehicles with VINs lower than JM1ND\*\*\*\*\*108746 (produced before December 14, 2014)

## DESCRIPTION

Some customers may complain that the seat belt comes out of the seat belt guide when the seat belt retracts as shown because the shape of the seat belt guide is inadequate.

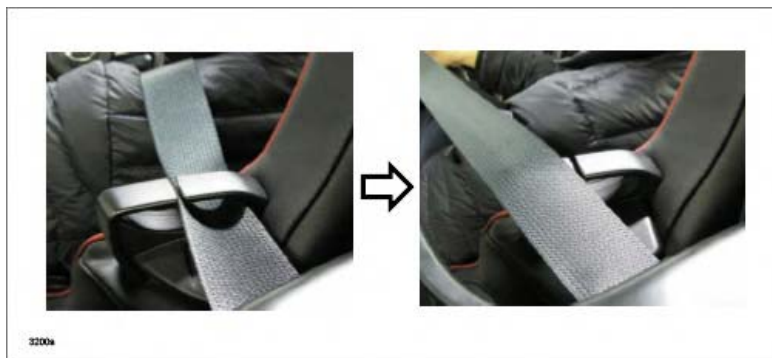

To correct the problem, the shape of the seat belt guide has been changed.

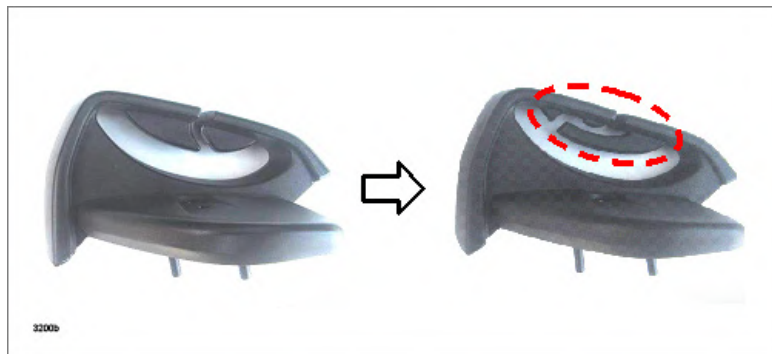

Customers having this concern should have their vehicle repaired using the following repair procedure.

## REPAIR PROCEDURE

1. Verify customer concern.
2. Remove two philips head screws on the seat belt guide, then replace the seat belt guide with a modified one (both sides).
3. Verify repair.

**CONSUMER NOTICE:** The information and instructions in this bulletin are intended for use by skilled technicians. Mazda technicians utilize the proper tools/equipment and take training to correctly and safely maintain Mazda vehicles. These instructions should not be performed by "do-it-yourselfers." Customers should not assume this bulletin applies to their vehicle or that their vehicle will develop the described concern. To determine if the information applies, customers should contact their nearest authorized Mazda dealership. Mazda North American Operations reserves the right to alter the specifications and contents of this bulletin without obligation or advance notice. All rights reserved. No part of this bulletin may be reproduced in any form or by any means, electronic or mechanical---including photocopying and recording and the use of any kind of information storage and retrieval system ---without permission in writing.

## PART(S) INFORMATION

Part Number	Description	Qty.	Notes
N243-88-1M7-02	Guide (L), Belt-Seat	1	Left side
N243-88-1L7-02	Guide (R), Belt-Seat	1	Right side

## WARRANTY INFORMATION

**NOTE:**

- This warranty information applies only to verified customer complaints on vehicles eligible for warranty repair.
- This repair will be covered under Mazda's New Vehicle Limited Warranty.
- Additional diagnostic time cannot be claimed for this repair.

Warranty Type	A
Symptom Code	74 (Poor maneuverability)
Damage Code	97 (Improper clearance)
Part Number Main Cause / Qty.	N243-88-1M7-02 / 1
Related Part Number / Qty.	N243-88-1L7-02 / 1
Operation Number / Labor Hours:	XXM3JXRX / 0.2 Hrs.