

© 2006 Mazda Motor of America, Inc.


Subject: WATER LEAK AT FRONT OF CONVERTIBLE TOP	Bulletin No: 09-013/06
	Last Issued: 4/20/2006

APPLICABLE MODEL(S)/VINS

2006 MX-5 with VINs lower than JM1 NC**** ** 113573 (produced before February 1, 2006)

DESCRIPTION

Customers may complain that during heavy rain, some vehicles may experience water leakage around the female wedge. Water is not completely draining from the drain hole and enters between the header weather-strip and windshield header panel.

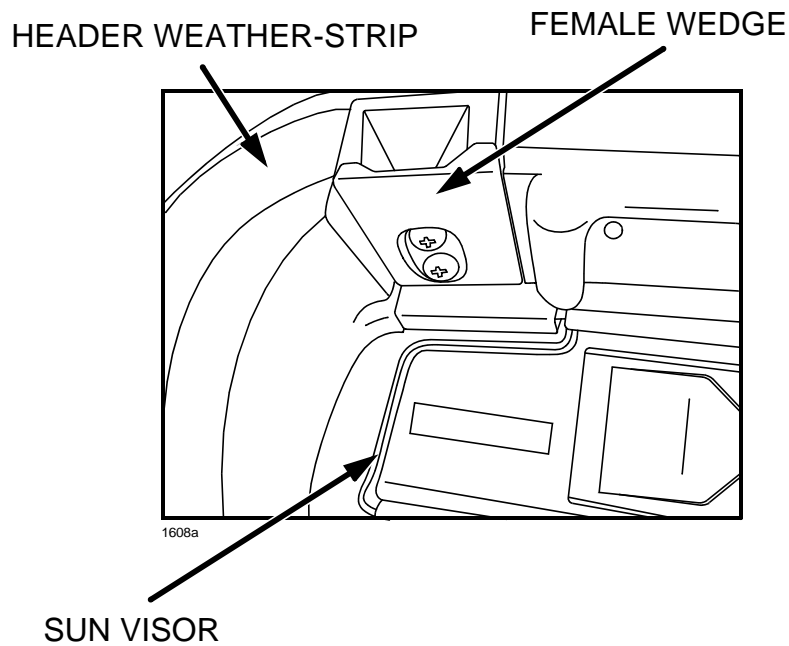


As a mass-production change, a pad has been added to the area between the header weather-strip and windshield header panel. Customers having this concern should have their vehicle repaired using the following repair procedure.


CONSUMER NOTICE: The information and instructions in this bulletin are intended for use by skilled technicians. Mazda technicians utilize the proper tools/equipment and take training to correctly and safely maintain Mazda vehicles. These instructions should not be performed by "do-it-yourselfers." Customers should not assume this bulletin applies to their vehicle or that their vehicle will develop the described concern. To determine if the information applies, customers should contact their nearest authorized Mazda dealership. Mazda North American Operations reserves the right to alter the specifications and contents of this bulletin without obligation or advance notice. All rights reserved. No part of this bulletin may be reproduced in any form or by any means, electronic or mechanical---including photocopying and recording and the use of any kind of information storage and retrieval system ---without permission in writing.

REPAIR PROCEDURE

1. Verify customer concern.
2. Remove the female wedge from the side where the water leakage occurs.

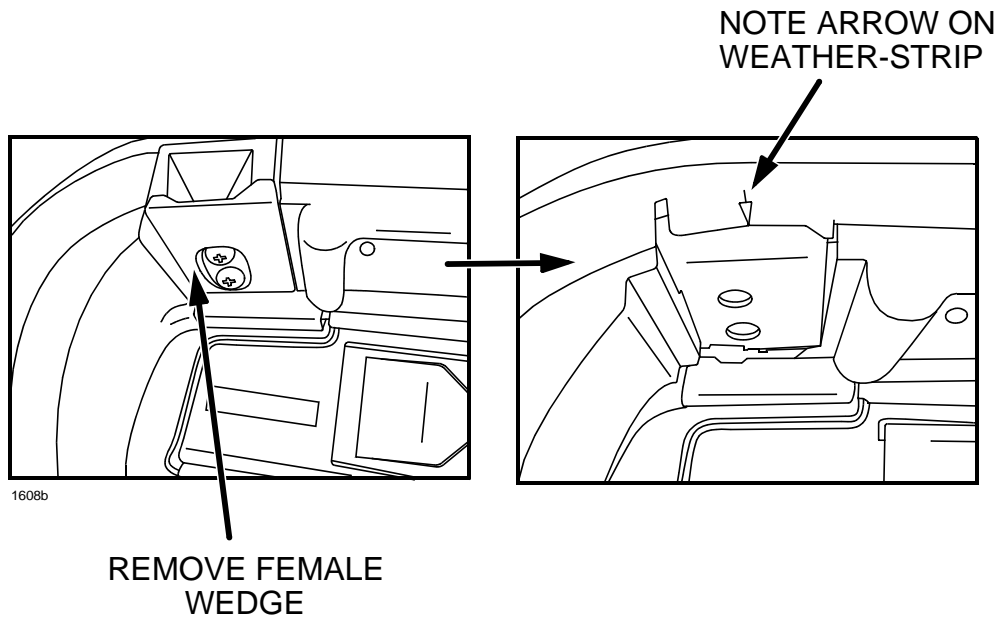

3. Roll up the lip of the weather-strip and confirm there is an indentation (dent) in the windshield header panel.

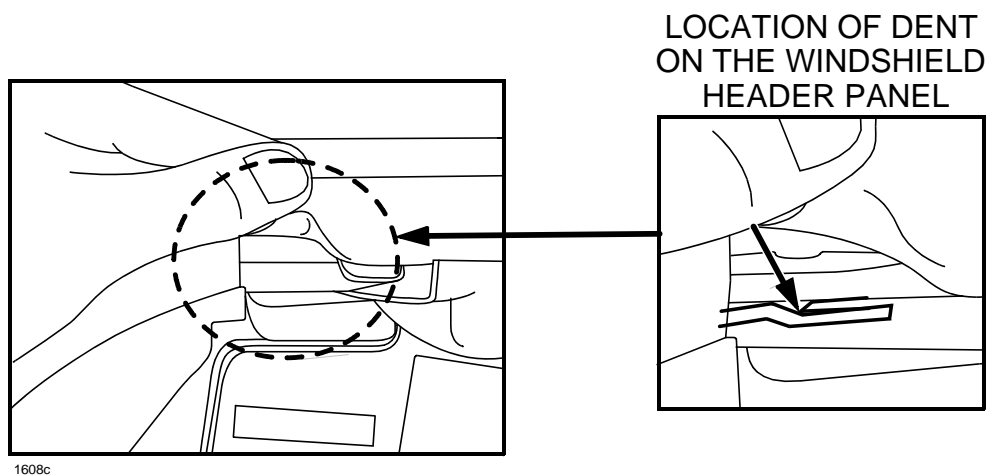


1608c


4. Press on the weather-strip at the dent area as shown using a Plastic Windshield Setting Tool (Part Number IS742 - available from Equalizer at 800-334-1334) or similar available through a local supplier.

PRESS THE WEATHER-STRIP AT THE AREA USING A PLASTIC WINDSHIELD SETTING TOOL OR EQUIVALENT


PRESS IN THIS DIRECTION

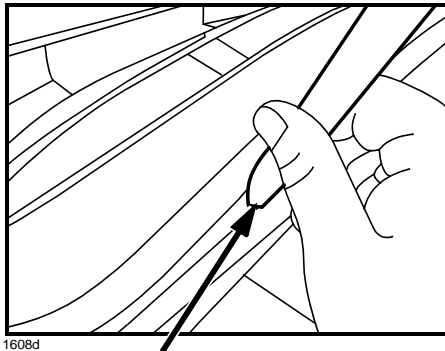


PRESS AT THIS POINT

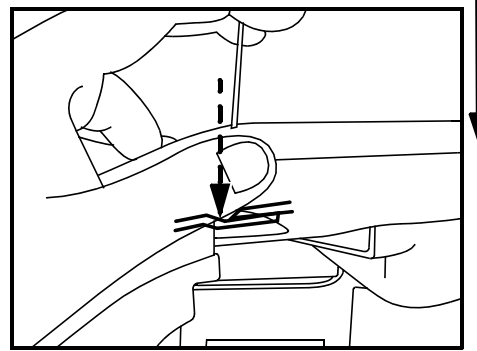

5. Roll up the lip of the weather-strip and insert the foam pad on the back side of the weather-strip as shown.

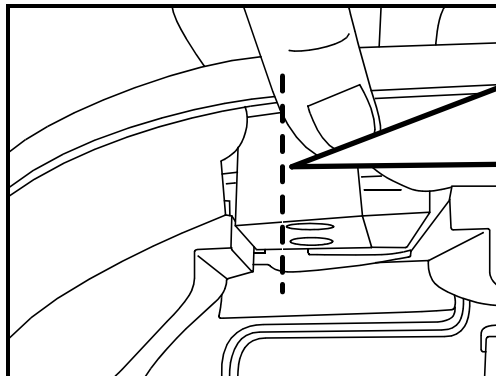


1608e

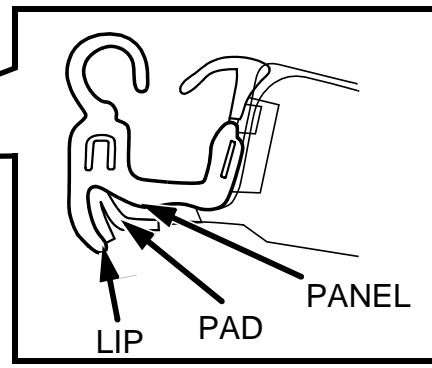

(CROSS-SECTION)

6. After attaching the foam pad, firmly press the weather-strip down where the foam pad was installed.

**FIRMLY PRESS THE WEATHER-STRIP
 OVER THE PAD**

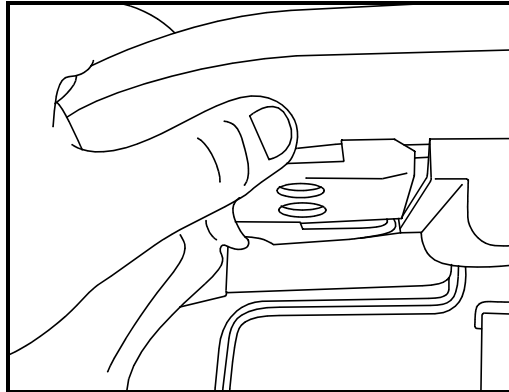

1608F

7. Install the female wedge.
 - a. Install the bolts hand tight.
 - b. Close and latch the convertible top.
 - c. Tighten female wedge bolts to specification.
8. Verify repair.

PART(S) INFORMATION

Part Number	Description	Qty.	Notes
NEY1-R1-433	Foam Pad	1	---

WARRANTY INFORMATION

NOTE:

- This warranty information applies only to verified customer complaints on vehicles eligible for warranty repair. Refer to the Warranty Wizard for warranty term information.
- Additional diagnostic time cannot be claimed for this repair.

Warranty Type	A
Symptom Code	77
Damage Code	9G
Part Number Main Cause	NEY1-R1-433
Quantity	1
Operation Number / Labor Hours:	XXB307R1 / 0.2 Hrs. (One side) XXB307R2 / 0.3 Hrs. (Both sides)