

Subject: SQUEAKING NOISE AROUND REAR CENTER CONSOLE LID	Bulletin No: 09-026/06
	Last Issued: 6/27/2006

APPLICABLE MODEL(S)/VINS

2006 MX-5 vehicles with VINs lower than JM1 NC**** ** 118186 (produced before May 10, 2006)

DESCRIPTION


Some vehicles may exhibit a squeaking noise from around the rear center console lid area when driving on a rough road or turning corners at slow speeds. Torque of the rear center console lid striker screw is insufficient. The tightening process has been revised in production.

Customers having this concern should have their vehicle repaired using the following repair procedure.

REPAIR PROCEDURE


1. Verify customer concern.
2. Open the center rear console lid and grasp the striker to verify if there is any movement of the striker.
 - If there is movement, go to STEP 3.
 - If there is no movement, continue to diagnose source of squeak.

BACK TRIM WITHOUT STORAGE BOX LIDS SHOWN

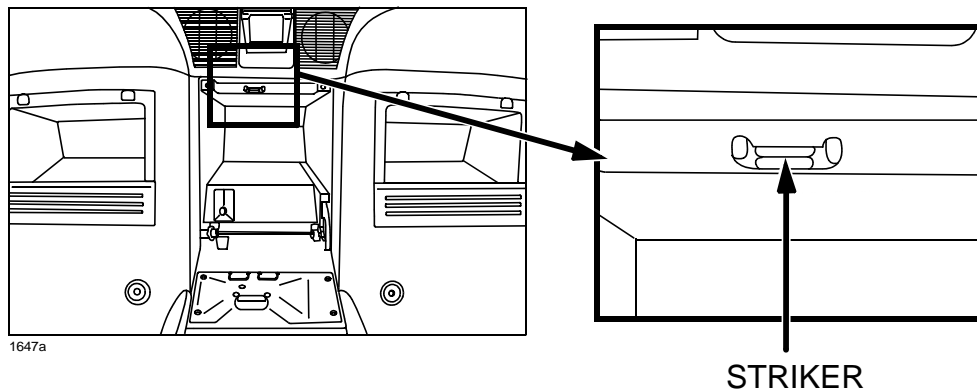

3. Remove the back trim. Refer to Workshop Manual section 09-17 BACK TRIM REMOVAL / INSTALLATION.

4. Tighten the 3 screws attaching the striker to the back trim.

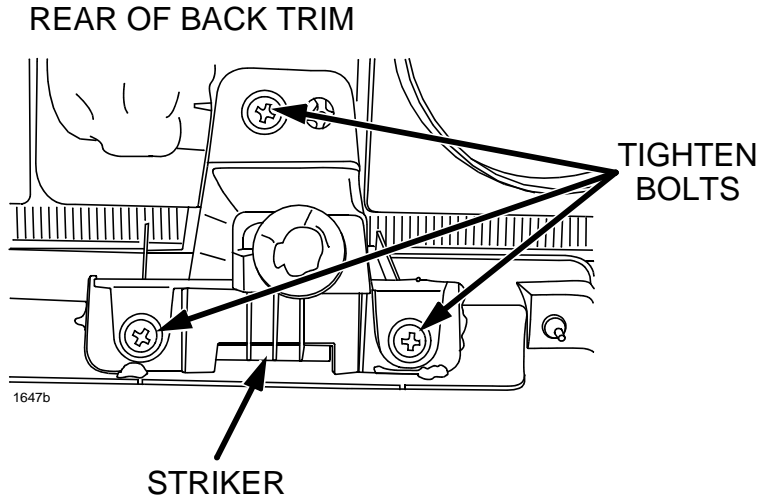

5. Reinstall the back trim.
6. Verify repair.

WARRANTY INFORMATION

NOTE:

- This warranty information applies only to verified customer complaints on vehicles eligible for warranty repair. Refer to the Warranty Wizard for warranty term information.
- Additional diagnostic time cannot be claimed for this repair.

Warranty Type	A
Symptom Code	82
Damage Code	9J
Part Number Main Cause	NE59-68-78XH-02 (Back trim without lid) NE51-68-78XD-02 (Back trim with lid)
Quantity	0
Operation Number / Labor Hours:	XXB349RX / 0.6 Hrs