

© 2007 Mazda Motor of America, Inc.

Subject: AM RADIO - POOR RECEPTION	Bulletin No: 09-010/07
	Last Issued: 3/21/2007

APPLICABLE MODEL(S)/VINS

2006-2007 MX-5 vehicles with VINs lower than JM1 NC**** ** 130963 (produced before November 8, 2006)


DESCRIPTION

Some vehicles may experience poor reception or excessive static when listening to AM radio stations. This condition may be the result of static electricity damaging the AM amplifier that is located at the base of the antenna.

The antenna amplifier circuitry has been improved to absorb static electricity. Customers having this concern should have their vehicle repaired using the following repair information.

REPAIR PROCEDURE

1. Verify customer concern.
2. Replace the manual antenna with a modified one. Refer to Workshop Manual section 09-20 MANUAL ANTENNA REMOVAL / INSTALLATION.

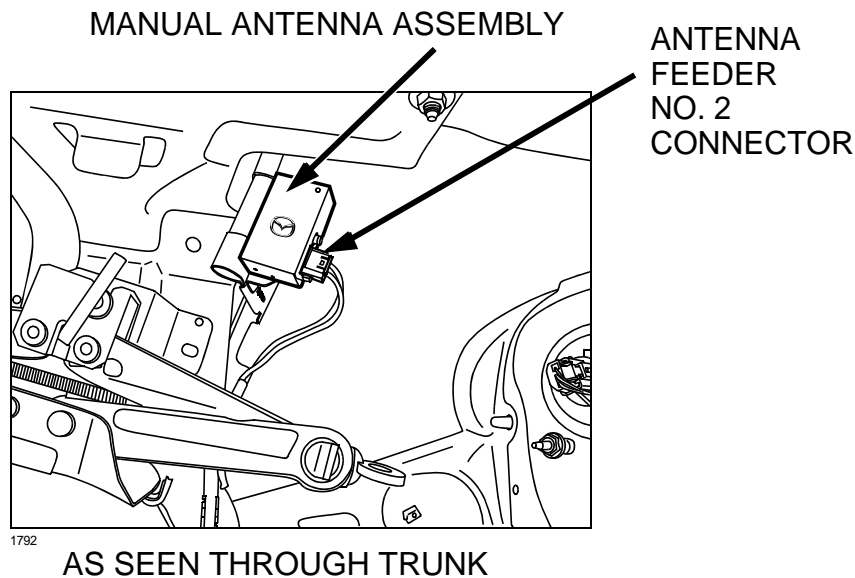

3. Verify repair.

Bulletin No: 09-010/07 © 2007 Mazda Motor of America, Inc.	Last Issued: 3/21/2007
--	-------------------------------

PART(S) INFORMATION

Part Number	Description	Qty.	Notes
NF79-66-930C	Manual Antenna	1	---

WARRANTY INFORMATION

NOTE:

- This warranty information applies only to verified customer complaints on vehicles eligible for warranty repair. Refer to the Warranty Wizard for warranty term information.
- Additional diagnostic time cannot be claimed for this repair.

Warranty Type	A
Symptom Code	B2
Damage Code	AB
Part Number Main Cause	NF79-66-930C
Quantity	1
Operation Number / Labor Hours:	XXC039RX / 0.3 Hrs