


2006-2013 MX-5, 2010-2013 Mazda3 AIRBAG LIGHT ON WITH DTC B1013 AND/OR B2290


Some customers may experience an airbag warning light on with DTC B1013 (seat weight sensor calibration error) and/or B2290 (passenger sensing system malfunction) stored in memory. This may be caused by foreign objects in the passenger seat rail system.

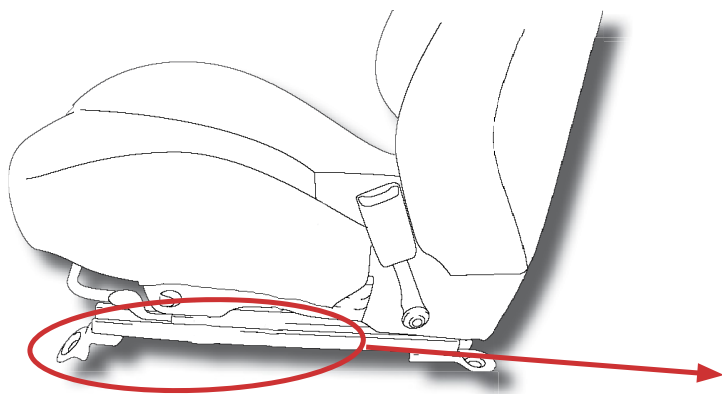

Remove the foreign object, then perform seat weight sensor calibration to resolve the concern.

Note: Replace the passenger seat rail assembly if:

- The foreign object cannot be removed.
- Seat weight sensor calibration fails after removing the foreign object.

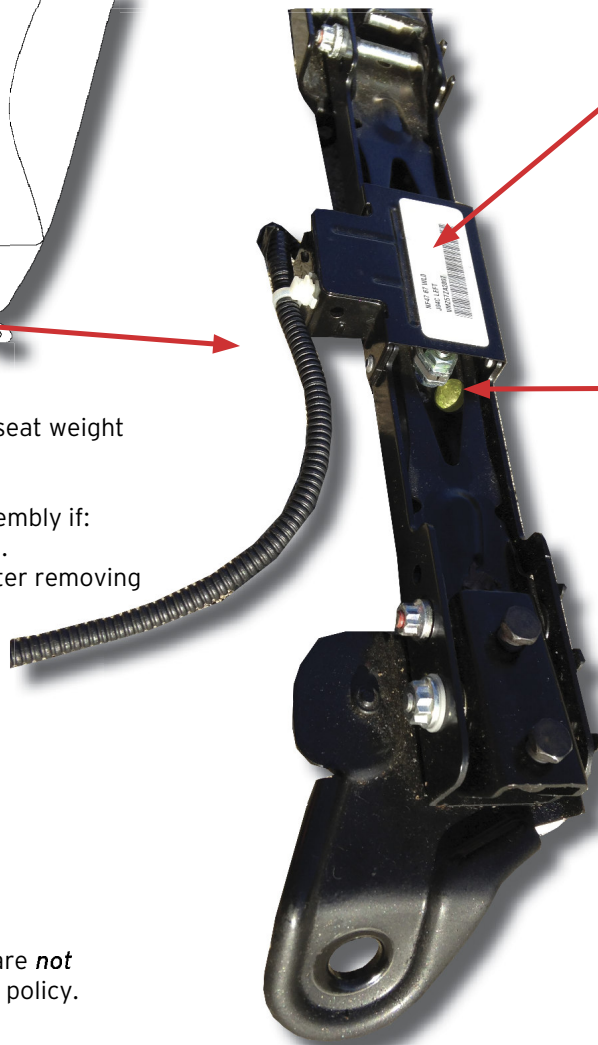

Seat weight sensor.

Foreign object jammed between the seat rail and seat weight sensor.

Warranty Compliance Note:

Vehicle repairs for this concern are *not covered* under Mazda's warranty policy.

Submit Your Own M-Tip Article!

If you have a valuable repair tip that you would like to submit for consideration in the next M-Tips Newsletter, please send by e-mail to mtips@mazdausa.com or by FAX to (949) 442-6599.

If we select your repair tip, you will receive a \$50 American Express Gift Cheque for your efforts.

Daniel Gonzalez - Editor (949) 442-6526

