Service Information

Mazda Motor Corporation

3-1, Shinchi, Fuchu-cho, Aki-gun Hiroshima 730-8670, Japan TEL: 81(82)287-5323 FAX: 81(82)287-5220




Category S	Repair Guidance		Ref. No. R075/15	Page 1 of 2
Coverage ☐ Distributor only ■ Please inform your dealers			Date Issued August 20, 2015	
Please convey this information t ■ Warranty Dept. ■ Parts De	ıl Manager Rep.	Date Revised		
Applicable Model MX-5 (ND)		Applicable Countries or Specifications North America, Europe, Australia, Thailand and Malaysia		

Subject: Front Scuff Plate easily comes off

DESCRIPTION

On some vehicles, the right and/or left side front scuff plate may easily come off with a little force, for instance when wiping it with cloth or removing the protective cover on it.

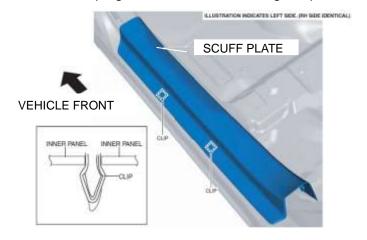

CAUSE

The retaining force of the scuff plate clips may be insufficient.

MASS PRODUCTION CHANGE

The shape of the scuff plate clips has been changed to increase the retaining force.

BEGINNING VIN & DATE OF MODIFICATION

Spec.	Beginning VIN		Date of Modification
ADR	JM0 ND **** **	100116	
GENERAL (R.H.D.)	JM6 ND **** **	100023	
GENERAL (L.H.D.)	JM7 ND **** **	100055	June 11, 2015
EC	JMZ ND **** **	101066	
US	JM1 ND **** **	101879	

REPAIR PROCEDURE

When you receive a customer complaint on this concern, replace the affected side scuff plate(s) with the modified one(s).

Refer to the workshop manual "SCUFF PLATE REMOVAL/INSTALLATION".

PARTS INFORMATION

Part Number		Dort Name	O'4v
New	Old	Part Name	Q'ty
N243 68 710A02	N243 68 710 02	Scuff Plate (RH)	1
N243 68 720A02	N243 68 720 02	Scuff Plate (LH)	1

WARRANTY INFORMATION

Assembly group	S - Body	
Subassembly group	04 - MOLDINGS & PROTECTORS	
Symptom Code	91	
Damage Code	97	
Causal Part No.	N243 68 710A02 / N243 68 720A02	
Q'ty	1	
Operation No.	XXL5JXRX (Scuff Plate, R&R one or both sides)	
Labor Hours	0.2 Hrs.	
Period Covered	Normal Warranty Period	

Ryu Shimizugawa Manager, Technical Information Gr. Technical Service Dept. Mazda Motor Corporation 1F52231054 (MC Internal Use)