# **Service Information**

Mazda Motor Corporation

3-1, Shinchi, Fuchu-cho, Aki-gun Hiroshima 730-8670, Japan TEL : 81(82)287-5323 FAX : 81(82)287-5220



Category S	Repair Guidance		Ref. No. R086/10 <mark>A</mark>	Page 1 of 3
Coverage □ Distributor only ■ Please inform your dealers			Date Issued October 29, 2010	
Please convey this information to your □ Director □ General Manage   Warranty Dept. □ Parts Dept. □ Training Dept. □ Field Rep.		8	Date Revised December 8, 2011	
Applicable Model		Applicable Countries or Specifications		
MX-5/Miata (NC)		Worldwide		

### [Updatec Note: "MASS PRODUCTION CHANGE" and "BEGINNING VIN & DATE OF MODIFICATION" have been updated.

# Subject: Poor Seat Belt Retraction

# DESCRIPTION

Some vehicles may experience that seat belt has been retracted slowly when the seat belt is unfastened.

# **CAUSE**

Dirt, dust or smudges increases the friction between the belt guide in the seat back shoulder area or the anchor area and the seat belt, and may cause the poor retraction.

### MASS PRODUCTION CHANGE

The shape of the belt guide will be changed and the friction resistance with the seat belt was reduced.

To reduce the friction resistance with the seat belt, shape of the belt guide has been changed.


# **BEGINNING VIN & DATE OF MODIFICATION**

US Spec.		
JM1 NC ******	216626	January 1, 2011
EC Spec.		
JMZ NC *****	253768	January 1, 2011
ADR Spec.		-
JM0 NC ******	202637	January 1, 2011
<b>General Spec.</b>		•
JM7 NC ******	202637	January 1, 2011

### **REPAIR PROCEDURE**

Clean the seat belt, belt guide, anchor and etc. of the affected seat belt. If this action does not solve the issue, replace right and left belt guide and protector with the improved ones. For details, refer to the following procedures.

# Note: Opening the convertible top enhances the accessibility.

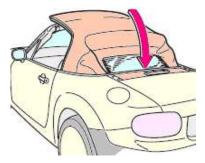

# 1. Confirm the retraction performance:


Fully pull out the seat belt and keep it in this position by hand. Release it and confirm the duration between releasing and completely pulling back.

### Note:

Avoid any interruption and resistances such like seat belt rubbing to the front seat while retraction, by assisting and guiding the belt with another hand during the retraction. If it takes about 2 seconds or less, the retraction performance is within the specification. **If not within specification:** Go to the next step.

# 2. Remove dirt, dust, smudges from the seat belt, the belt guide and the anchor area according to Owner's Manual:

Clean the webbing with a mild soap solution recommended for upholstery or carpets. Follow the instructions. Don't bleach or dye the webbing, this may weaken it. After cleaning the belts, thoroughly dry the belt webbing and male sure there is no remaining moisture before retracting them.

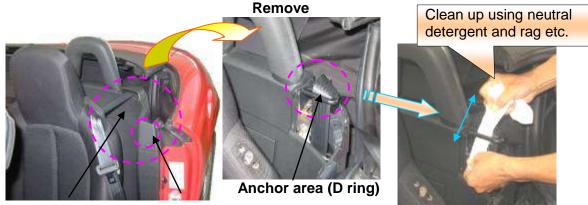

Anchor cover

Fastener


\*Cleaning of anchor area: Remove the fastener and the anchor cover to remove smudges on the seat belt anchor area (D ring).

Confirm the retraction performance after cleaning.

If now within specification: Make sure that the customer takes care of the interior maintenance such like seat belt (removal of smudges) on a regular basis. If not within specification: Go to the next step.


# 3. Replace the seat belt guide & the protector with the modified ones. (Both Sides)

(1) Remove the seat belt guide (combined with the protector).Loosen the attachment screw and remove the seat belt guide & protector.

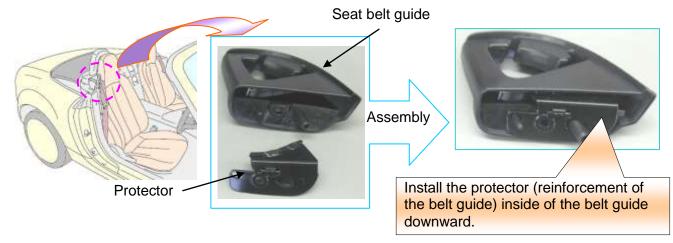

(2) Assembly new seat belt guide & new protector, then install it using original screw.

Note: \*The shape of the belt guide (Service parts) has been changed as illustration.

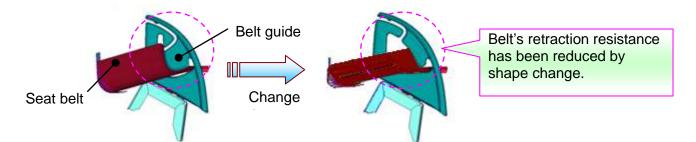

- (3) Confirm the performance of seat belt retraction and if it's not improved, clean up the seat belt & anchor area again.
- (4) Make sure cleanness and installation of each part is kept in a good condition.

# PART INFORMATION

Part Number *		Dort Nomo	O'tu	Demork	
New	Old	Part Name	Q'ty	Remark	
NHY8 88 1L7	NE51 88 1L7 02 NG90 88 1L7 02 NH52 88 1L7 02	Belt Guide (Right)	1	Always replace belt guide and protector simultaneously because	
NHY8 88 1M7	NE51 88 1M7 02 NG90 88 1M7 02 NH52 88 1M7 02	Belt Guide (Left)	1	shapes of the belt guide are different.	
NHY8 88 1J1	NE51 88 1J1	Protector (Right)	1		
NHY8 88 1K1	NE51 88 1K1	Protector (Left)	1		

Note: \*Select part number according to EPC.

### WARRANTY INFORMATION

Symptom Code	71
Damage Code	9E
Causal Part No.	NHY8 88 1L7
Q'ty	1
Operation No.	XXF4FXRX
Labor Hours	0.3 H (One Side or Both Sides)
Period Covered	Normal Warranty Period

Note: Including cleaning time for belt and anchor area.

Shinji Kanai Manager, Technical Information Gr. Technical Service Dept. Mazda Motor Corporation 1941370924 (MC Internal Use)