

2008-2013 MX-5


POWER RETRACTABLE HARDTOP WILL NOT OPEN / CLOSE AND / OR RATTLE TYPE NOISE

Some customers may complain about the following power retractable hardtop concerns:

- Slow to open or close.
- Does not open or close.
- "Rattle" type noise caused by hardtop linkage out of alignment.

These concerns may be caused by an aftermarket device (see image below) allowing the hardtop to open or close when the vehicle is in motion.

This condition may overstress the hardtop retractable motors and linkages, causing premature motor failure and/or linkage misalignment.

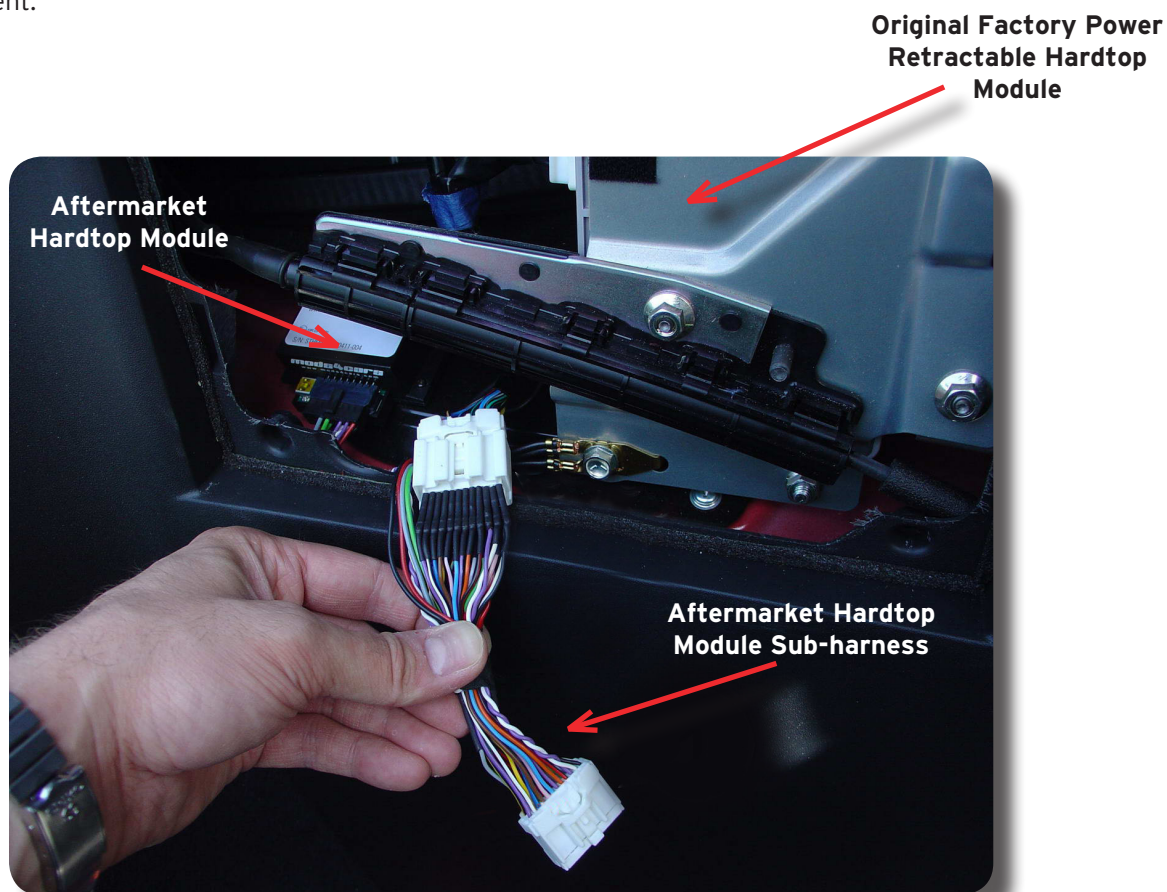

Warranty Compliance Note:

Replacement of the power retractable hardtop motor(s) or linkage adjustments are not covered under Mazda's warranty policy if the vehicle has been modified.